## NATIONAL BUREAU OF STANDARDS REPORT

6422

POTENTIOMETER FOR MEASUREMENT OF SMALL PHOTOELECTRIC CURRENTS

> By C. A. Douglas M. R. Freund



U. S. DEPARTMENT OF COMMERCE NATIONAL BUREAU OF STANDARDS

#### THE NATIONAL BUREAU OF STANDARDS

## **Functions and Activities**

The functions of the National Bureau of Standards are set forth in the Act of Congress, March 3, 1901, as amended by Congress in Public Law 619, 1950. These include the development and maintenance of the national standards of measurement and the provision of means and methods for making measurements consistent with these standards; the determination of physical constants and properties of materials; the development of methods and instruments for testing materials, devices, and structures; advisory services to Government Agencies on scientific and technical problems; invention and development of devices to serve special needs of the Government; and the development of standard practices, codes, and specifications. The work includes basic and applied research, development, engineering, instrumentation, testing, evaluation, calibration services, and various consultation and information services. A major portion of the Bureau's work is performed for other Government Agencies, particularly the Department of Defense and the Atomic Energy Commission. The scope of activities is suggested by the listing of divisions and sections on the inside of the back cover.

## Reports and Publications

The results of the Bureau's work take the form of either actual equipment and devices or published papers and reports. Reports are issued to the sponsoring agency of a particular project or program. Published papers appear either in the Bureau's own series of publications or in the journals of professional and scientific societies. The Bureau itself publishes three monthly periodicals, available from the Government Printing Office: The Journal of Research, which presents complete papers reporting technical investigations; the Technical News Bulletin, which presents summary and preliminary reports on work in progress; and Basic Radio Propagation Predictions, which provides data for determining the best frequencies to use for radio communications throughout the world. There are also five series of nonperiodical publications: The Applied Mathematics Series, Circulars, Handbooks, Building Materials and Structures Reports, and Miscellaneous Publications.

Information on the Burean's publications can be found in NBS Circular 460, Publications of the National Bureau of Standards (\$1.25) and its Supplement (\$0.75), available from the Superintendent of Documents, Government Printing Office, Washington 25, D. C.

Inquiries regarding the Bureau's reports should be addressed to the Office of Technical Information, National Bureau of Standards, Washington 25, D. C.

## NATIONAL BUREAU OF STANDARDS REPORT

NBS PROJECT

NBS REPORT

0201-20-2331

June 1959

6422

Potentiometer for Measurement Of Small Photoelectric Currents

> By C. A. Douglas M. R. Freund

For Aeronautical Accessories Laboratory Wright Air Development Center Wright-Patterson Air Force Base Ohio

#### IMPORTANT NOTICE

NATIONAL BUREAU OF STAND/ intended for use within the Gover to additional evaluation and review listing of this Report, either in wh the Office of the Director, Nationa however, by the Government agen to reproduce additional copies for

Approved for public release by the director of the National Institute of Standards and Technology (NIST) on October 9, 2015

ess accounting documents y published it is subjected duction, or open-literature s obtained in writing from permission is not needed, ared if that agency wishes



U. S. DEPARTMENT OF COMMERCE NATIONAL BUREAU OF STANDARDS



6422

# Potentiometer for Measurement of Small Photoelectric Currents

## 1. INTRODUCTION

In order to obtain sufficient accuracy in the chromaticity determinations made with a photoelectric tristimulus colorimeter, relative measurements must be made of very small photoelectric currents (of the order of 10<sup>-10</sup> to 10<sup>-11</sup> ampere) with three-place accuracy. The present commercially available micro-microammeters have more than sufficient sensitivity for the purpose, but the uncertainties in relative measurements made with these instruments are about ten times the acceptable uncertainties.

Measurements of the voltage drop which is developed across a high-resistance load by the photoelectric current can be made with a potentiometer with sufficient accuracy when the potentiometer is used with a sensitive low-current galvanometer as a null detector. For convenience of operation an "electronic galvanometer" should be used. Figure 1 is an elementary diagram of a system of this type. The voltage developed across the load resistor of the phototube is balanced by the voltage between the slider on potentiometer R<sub>I</sub> and the slider on potentiometer R<sub>IV</sub>. Since a range of photoelectric currents must be measured, a number of "hi-meg" load resistors (RL1, RL2, and RL3) and a suitably insulated selector switch (S<sub>L</sub>) are required. Since only relative measurements of current are required, adjustment of the current through the potentiometer slide wire is not required. This current must, however, be stable.

## 2. THEORY OF OPERATION

A study of the circuitry of the General Radio Model 1230A Electrometer-Amplifier indicated that this instrument could be modified so that it could not only function as the "electronic galvanometer" shown in figure 1 with the sensitivity controlled by the VOLTS switch of the instrument, but that the input resistors and the input-resistance switch could be used as the load resistors for the phototube and switch SL respectively. Figure 2 is an elementary schematic diagram of the modified electrometer-amplifier with a circuit diagram of the potentiometer, and figure 3 is a circuit diagram of the electrometer-amplifier showing the modifications.

Potentiometer R<sub>IV</sub> is a 100.000-ohm ten-turn precision potentiometer with a linearity tolerance of 0.05%. Two D-size mercury flashlight cells (Mallory type RM-42-R) connected in series are used as the potentiometer battery E<sub>B</sub> in order to obtain sufficient stability in the potentiometer current.



Potentiometer RI is used to balance out the voltage developed across across the load resistor by the phototube dark current and by the phototube current resulting from background illumination.

Resistors  $R_V$  and  $R_{VI}$  have been adjusted by the addition of trimming resistors in parallel or series to reduce the voltage drop across potentiometer  $R_{IV}$  to precisely one-third the normal value without changing the current through  $R_{III}$ . This expands the lower end of the potentiometer scale without changing the dark-current balance.

All added components except the POTENTIOMETER switch are housed in a shielded compartment attached to the bottom of the electrometer-amplifier. (See figs. 3, 5, 6.) The POTENTIOMETER switch is located in the upper left-hand corner of the instrument.

Note that the circuits of the electrometer-amplifier have been so modified that the photometer is connected between the INPUT terminal of the electrometer and ground. Thus the electrometer can be used either as a meter (as designed) or as a null detector (as modified) without changing connections of the input circuit.

When the instrument is used as a potentiometer, terminal E must be connected to ground (as is done in the modification), not to the "P-terminal" side of the instrument. Otherwise that part of the potentiometer RIV between the slider and ground will be shunted by R15 of the electrometer, thereby decreasing the linearity of the voltage drop along potentiometer RIV.

Practical wiring diagrams showing the modifications made in the circuitry of the electrometer are shown in figure 4. Figure 5 shows front and rear views of the modified instrument with the added potentiometer compartment attached to the electrometer. Figure 6 is a photograph of the interior of the potentiometer compartment.

## 3. ACCURACY OF MEASUREMENTS

Voltage differences of the order of 0.1 millivolt can be detected readily when the range switch of the electrometer is in the 30-millivolt position. However, since the linearity tolerance of the 10-turn potentiometer is 0.05% of full scale, the linearity error of the potentiometer could provide an uncertainty in the voltage measurements as large as 0.05% of the voltage applied across the potentiometer; that is, about 1 millivolt when the BATTERY SWITCH is in the HIGH position and 0.3 millivolt when this switch is in the LOW position.

Because of the possibility of other errors and instabilities in the electrometer, the maximum uncertainty in the measurement of relative currents is about 0.1% of the current which can be balanced by using the full voltage across the potentiometer. When the BATTERY SWITCH is in the HIGH position this error is approximately 0.002 /r microampere where r is the input



resistance. When the BATTERY SWITCH is in the LOW position, the maximum uncertainty in the relative current is approximately 0.007 / r microampere.

Results of tests of the linearity and accuracy of the modified electrometer are given in table 1. In making these tests, a precision laboratory potentiometer was used to determine the applied voltage.

Table I. Calibration Check of Electrometer-Potentiometer

POTENTI OMETER - BALANCE	RELATIVE INPUT BATTERY SWITCH ON	
Setting	HIGH	LOW
1000	1.0000	.3341
950	.9505	
900	.8999	.2998
850	.8500	-
800	.7998	
750	.7493	.2492
700	.6994	•
650	. 6494	
600	.5989	.1985
550	. 5488	
500	.4986	
450	.4485	.1486
400	.3986	
350	.3487	
300	.2980	.0985
250	.2486	
200	.1989	
150	.1490	.0493
100	.0990	
50	.0491	

#### 4. OPERATION

## 4.1 Normal Operation

To operate the unit as an indicator (normal manner), turn the POTENTIOMETER switch (in upper left corner of panel) to NORMAL. The instrument will then operate as designed. Consult General Radio Instruction Book for further details.



## 4.2 Operation as a Potentiometer

To operate the unit as a potentiometer, connect terminal P on the potentiometer compartment to terminal P on the electrometer case. Connect the ground terminal on the potentiometer compartment to the ground terminal of the electrometer. Turn GROUND switch to E and POTENTIOMETER switch to POTENTIOMETER. With OUTPUT circuit open or with power off, adjust mechanical zero of meter to zero. Depress ZERO switch. Turn POTENTIOMETER BALANCE to its zero position. Close output circuit (or turn power back on). Allow instrument to stabilize. Leave BATTERY SWITCH of the potentiometer section in the OFF position. Use the electrical ZERO adjustment of the electrometer to adjust the electrical zero. During the final stages of the adjustment, put the VOLTS switch in the 30 MV position to obtain the most accurate zero setting. Turn VOLTS switch to 3 volts. Turn BATTERY SWITCH to HIGH. Use the DARK CURRENT BALANCE adjustment to reset the electrical zero of the system, turning the VOLTS switch to the 30-millivolt position during the final stages of adjustment. The instrument is now adjusted for a dark current equal to zero. Turn VOLTS switch to 3 volts and release the ZERO switch. The electrometer now operates as a sensitive. very low-current galvanometer with a deflection which is proportional to the difference between the voltage applied between the INPUT terminal and ground and the voltage between terminal P and ground with an error sensitivity (in millivolts per meter division) determined by the position of the VOLTS switch.

4.3 Potentiometric Measurement of Voltage (Maximum Voltage 2 Volts)

Make adjustments outlined in Section 4.2

Set the INPUT RESISTANCE selector switch to an appropriate value. Set the BATTERY SWITCH to HIGH. Set the VOLTS switch to 3 volts. Connect the positive side of the unknown voltage to the INPUT terminal and the negative side to ground. Use the POTENTIOMETER BALANCE adjustment to obtain a meter reading of zero. Turn the VOLTS switch by steps to the 30-millivolt range as an approximate balance is obtained. Since the voltage drop across the potentiometer is not standardized, only relative measurements of voltage can be obtained unless the instrument is calibrated by measuring a source of known voltage such as a standard cell.

By turning the BATTERY SWITCH to the LOW position, the voltage across the potentiometer is reduced to precisely one-third of the voltage across the potentiometer when this switch is in the HIGH position. Hence, the potentiometer reading is increased by a factor of 3.000.



If measurement of the change in voltage only is wanted, the instrument can be used as a deflection potentiometer by balancing out the initial input voltage by means of the POTENTIOMETER BALANCE. When the 30 MV range is used, the changes in voltage can then be read on the meter of the electrometer with an uncertainty of about 0.3 millivolts or 2% of the change in voltage, whichever is greater.

## 4.4 Potentiometric Measurement of Current

Current is measured by determining the voltage drop across one of the input resistors of the electrometer. Therefore, after a suitable input resistor is selected, measurements of current are made using the procedure used in the measurement of voltage. Determine the proper input resistor by turning the POTENTIOMETER switch to NORMAL (or turning this switch to POTENTIOMETER and the POTENTIOMETER BALANCE to its zero position) and turn the VOLTS switch to 3 volts. Then turn the INPUT RESISTANCE switch to the maximum resistance which will produce a voltage under 2 volts for all currents to be measured. If the maximum voltage obtained is between 0.7 and 2 volts, turn the BATTERY SWITCH to HIGH. If the voltage is below 0.7 volt, turn the BATTERY SWITCH to LOW. Turn the POTENTIOMETER switch to POTENTIOMETER and balance the system with the POTENTIOMETER BALANCE, turning the VOLTS switch to 30 MV for the final balance.

Since the current through the 10-turn potentiometer is not standardized, only relative measurements can be made. Since the values of the high-resistance input resistors are not known accurately, all relative measurements in a given group should be made using the same input resistor.

## 4.5 Dark-Current Balance

When photoelectric currents are measured, it is often desirable to compensate for the dark current of the phototube and the background illumination. This compensation can be accomplished by means of the DARK CURRENT BALANCE. After adjusting the electrical zero of the electrometer, as outlined in Section 4.2, set the INPUT RESISTANCE switch to the resistance which will be used and place the BATTERY SWITCH to the position in which it will be used. Connect the photoelectric receiver. With the light under test off, use the DARK CURRENT BALANCE to obtain a zero reading of the electrometer.

Note: The DARK CURRENT BALANCE must be readjusted whenever the setting of the INPUT RESISTANCE is changed or whenever the background illumination changes.



#### 4.6 Discussion

If more precise measurements of voltage are required, the unmodified electrometer can be used in place of the usual galvanometer in conjunction with a precision potentiometer. The current drain of the electrometer is much less than the drain of the usual D'Arsonval galvanometer. Measurements of current can be made similarly by measuring the voltage developed across an external resistor of precisely known value. In this case the INPUT RESISTANCE switch should be turned to the position.

If the effects of alternating-current pick-up are troublesome, they can often be reduced by reversing the connections to input power, by grounding the case of the instrument, or by doing both. If these procedures are not effective, a resistance-capacitance filter of the type shown in NBS Report 5294 should be connected between the INPUT terminal and ground. For ease in balancing the potentiometer, keep the time constant of this filter as small as feasible.

## 5. SERVICING


The mercury batteries used to supply the potentiometer current should be replaced yearly. The batteries are fastened to the cover plate on the bottom of the potentiometer compartment and may be reached by removing this plate.

To remove the potentiometer compartment, turn catch on back of the potentiometer compartment to the horizontal position and slide the compartment forward after removing the connecting wires at back of unit.

To remove the electrometer chassis, remove the potentiometer compartment, then remove the four countersunk screws which pass through the plate attached to the bottom of the electrometer case and the two screws at the top of the case. Slide the chassis forward and out.

Consult the General Radio manual for servicing details.



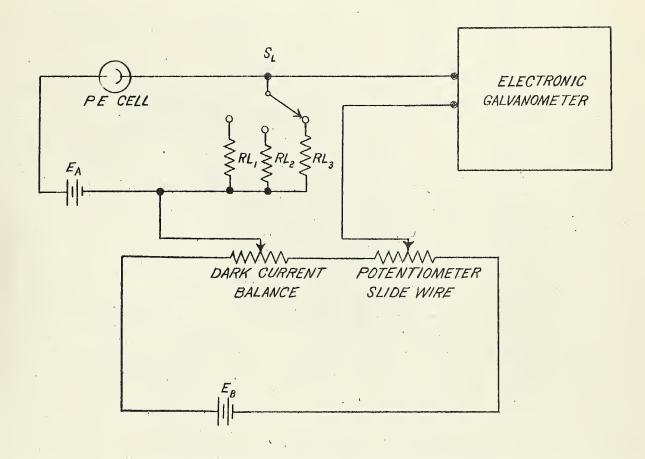


ELEMENTARY SCHEMATIC DIAGRAM OF ELECTROMETER-POTENTIOMETER

NBS REPORT 6422

FIGURE 1




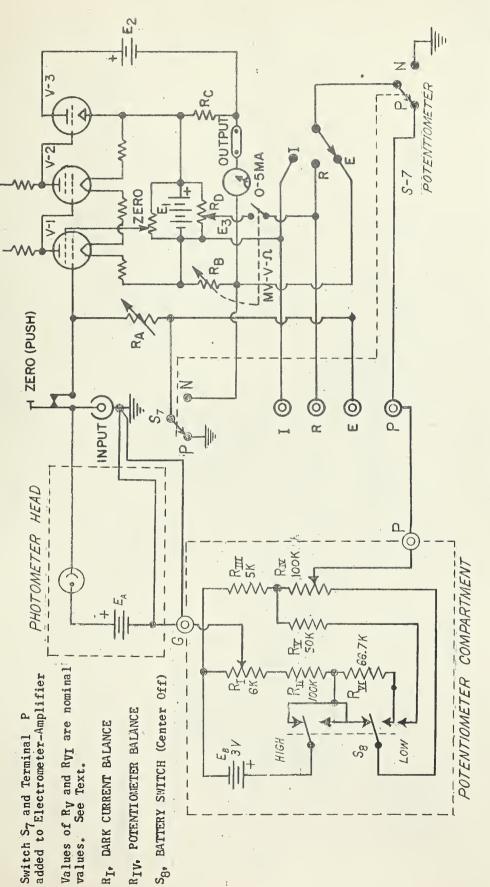

POTENTIOMETER AND ELEMENTARY SCHEMATIC DIAGRAM OF MODIFIED GENERAL RADIO TYPE 1230-A D-C AMPLIFIER AND ELECTROMETER

NBS REPORT 6422



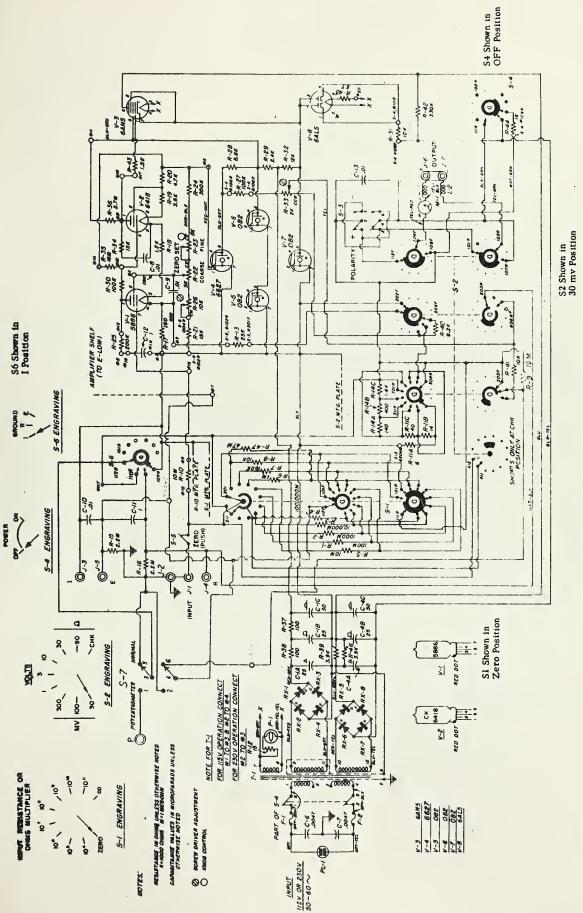

Detailed Schematic Diagram of Modified Type 1230-A D-C Amplifier and Electrometer


'PS Report 6422


Figure 3




PRACTICAL WIRING DIAGRAM SHOWING MODIFICATION OF MODEL 1230-A ELECTROMETER


WBS REPORT 6422




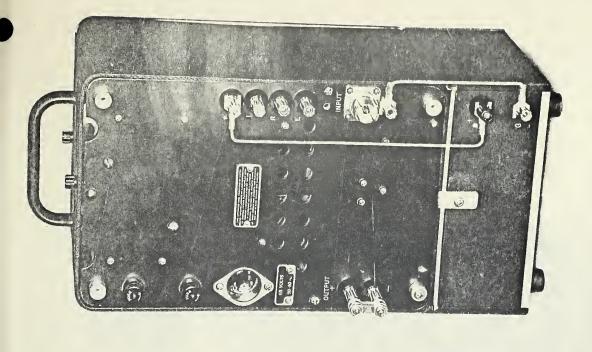

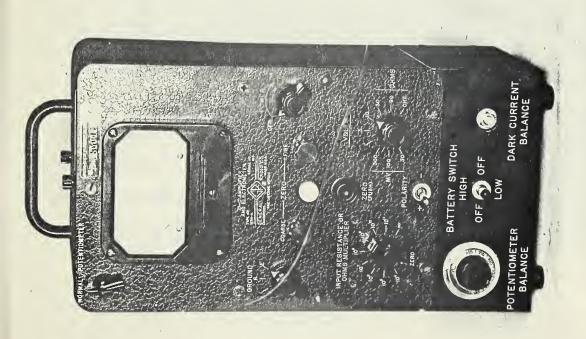

NBS REPORT 6422



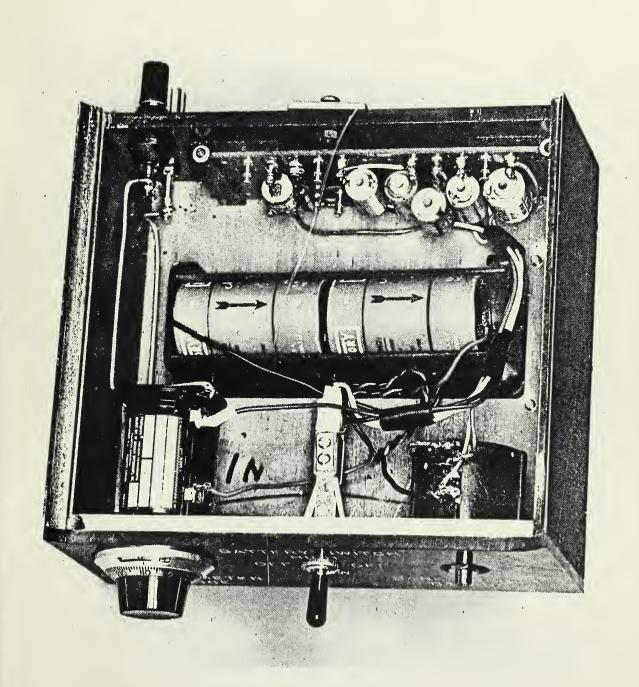

INSIDE VIEW OF POTENTIOMETER COMPARTMENT

13S REPORT 6422



## NATIONAL BUREÁU OF STANDARDS A. V. Astin, Director



## THE NATED NATED TO SHEED A BRUDE A BRUDE A STANDARD A BEED SO

The scope of activities of the National Bureau of Standards at its headquarters in Washington, D. C., and its major laboratories in Boulder, Colo., is suggested in the following listing of the divisions and sections engaged in technical work. In general, each section corries out specialized research, development, and engineering in the field indicated by its title. A brief 'description of the activities, and of the resultant publications, appears on the justice front cover.

## WASHINGTON, D. C.

- Electricity and Electronics. Resistance and Reactance. Electron Devices. Electrical Instruments. Magnetic Measurements. Dielectrics. Engineering Electronics. Electronic Instrumentation.
- Optics and Metrology. Photometry and Colorimetry. Optical Instruments. Photographic Technology. Length. Engineering Metrology.
- **Heat.** Temperature Physics. Thermodynamics. Cryogenic Physics. Rheology. Engine Fuels. Free Radicals Research.
- Atomic and Radiation Physics. Spectroscopy. Radiometry. Mass Spectrometry. Solid State Physics. Electron Physics. Atomic Physics. Neutron Physics. Radiation Theory. Radioactivity. X-rays. High Energy Radiation. Nucleonic Instrumentation. Radiological Equipment.
- Chemistry. Organic Coatings. Surface Chemistry. Organic Chemistry. Analytical Chemistry. Inorganic Chemistry. Electrodeposition. Molecular Structure and Properties of Gases. Physical Chemistry. Thermochemistry. Spectrochemistry. Pure Substances.
- Mechanics. Sound. Mechanical Instruments. Fluid Mechanics. Engineering Mechanics. Mass and Scale. Capacity, Density, and Fluid Meters. Combustion Controls.
- Organic and Fibrous Materials. Rubber. Textiles. Paper. Leather. Testing and Specifications. Polymer Structure. Plastics. Dental Research.
- Metallurgy. Thermal Metallurgy. Chemical Metallurgy. Mechanical Metallurgy. Corrosion. Metal Physics.
- Mineral Products. Engineering Ceramics. Glass. Refractories, Enameled Metals. Concreting Materials. Constitution and Microstructure.
- Building Technology. Structural Engineering. Fire Protection. Air Conditioning, Heating, and Refrigeration. Floor, Roof, and Wall Coverings. Codes and Safety Standards. Heat Transfer.
- Applied Mathematics. Numerical Analysis. Computation. Statistical Engineering. Mathematical Physics.
- Bata Processing Systems. SEAC Engineering Group. Components and Techniques. Digital Circuitry. Digital Systems. Anolog Systems, Application Engineering.
  - Office of Basic Instrumentation. Office of Weights and Measures.

## BOULDER, COLORADO

- Cryogenic Engineering. Cryogenic Equipment. Cryogenic Processes. Properties of Materials. Gas Liquefaction.
- Radio Propagation Physics. Upper Atmosphere Research. Ionospheric Research. Regular Propagation Services. Sun-Earth Relationships. VIIF Research. Ionospheric Communication Systems.
- Itadio Propagation Engineering. Data Reduction Instrumentation. Modulation Systems. Navigation Systems. Radio Noise. Tropospheric Measurements. Tropospheric Analysis. Radio Systems Application Engineering. Radio-Meteorology.
- Frequency Impedance Standards. Electronic Calibration Center. Microwave Physics, Microwave Circuit Standards.

